

BAWER **ADVICE**

ITALIANO

Per il corretto assemblaggio, consultare la presente scheda di montaggio e la scheda di sicurezza allegata. Si raccomanda la verifica del serraggio con frequenza semestrale.

ENGLISH

For correct assembly, refer to this assembly sheet and the enclosed safety data sheet. We recommend checking the tightening every six months.

FRANÇAIS

Pour le correct assemblage, veuillez consulter la fiche de montage et la fiche de sécurité en pièce jointe. Nous vous recommandons de bien vérifier le serrage tous les six mois.

ESPAÑOL

Para un montaje correcto, consultar esta hoja de montaje y ficha de seguridad suministrada. Se recomienda la verificación del ajuste cada seis meses.

DEUTSCH

Für die korrekte Montage, beziehen Sie sich bitte auf das Montageblatt und das beigefügte Sicherheitsblatt. Wir empfehlen die Schrauben halbjährlich zu überprüfen und ggf. nachzuziehen.

 
ASSEMBLY **STEP 1**

CHECK WHICH TUBE YOU HAVE

FOUR POSITIONS




SIX POSITIONS



FAST MOUNTING - MULTI HOLES TUBE

CHECK INFO
BELOW

Follow the instructions:

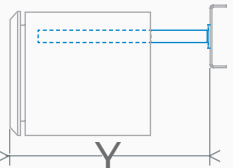

Check which distance “Y” you need and **cut** the tube following the **red line**.
After cutting it is recommended to use an anticorrosive paint.

Then go to **STEP 2**

TUBE FOR TOOLBOX
WIDTH **L500**




cut here --- Y4 474 mm.
cut here --- Y3 502 mm.
cut here --- Y2 530 mm.
Y1 558 mm.

TUBE FOR TOOLBOX
WIDTH **L600/L800/L1000**




cut here --- Y6 546 mm.
cut here --- Y5 574 mm.
cut here --- Y4 602 mm.
cut here --- Y3 630 mm.
cut here --- Y2 658 mm.
Y1 686 mm.

EXAMPLE OF CUTTING TUBE

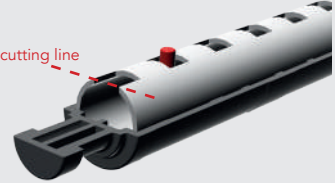



EXAMPLE OF ASSEMBLED TUBE

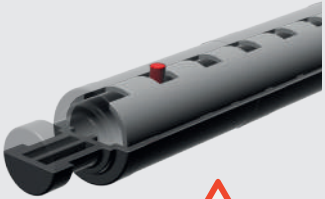

WARNING 1

ASSEMBLY **STEP 2**

Toolbox width	L
500	414 mm.
600	508 mm.
800	708 mm.
1000	908 mm.

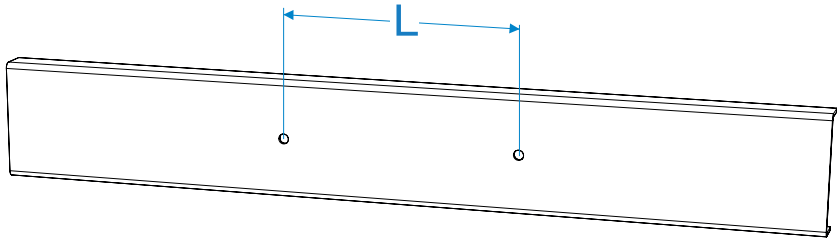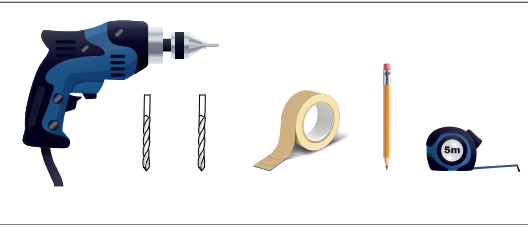


ASSEMBLY **STEP 3**

Screw	Torque
M12	86 Nm
M18 x 1,5	325 Nm




Follow the instructions:
Screw - **Torque**

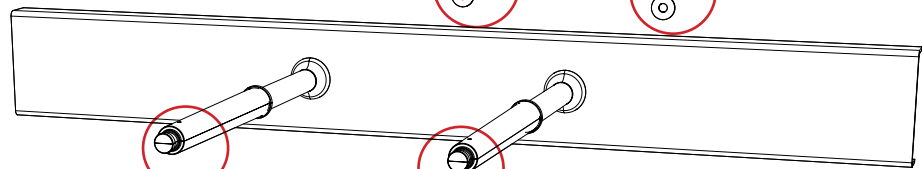

WARNING 2

Refer to the attached sheet:
Fast Mounting Product
Safety Data Sheet


ASSEMBLY **STEP 4**

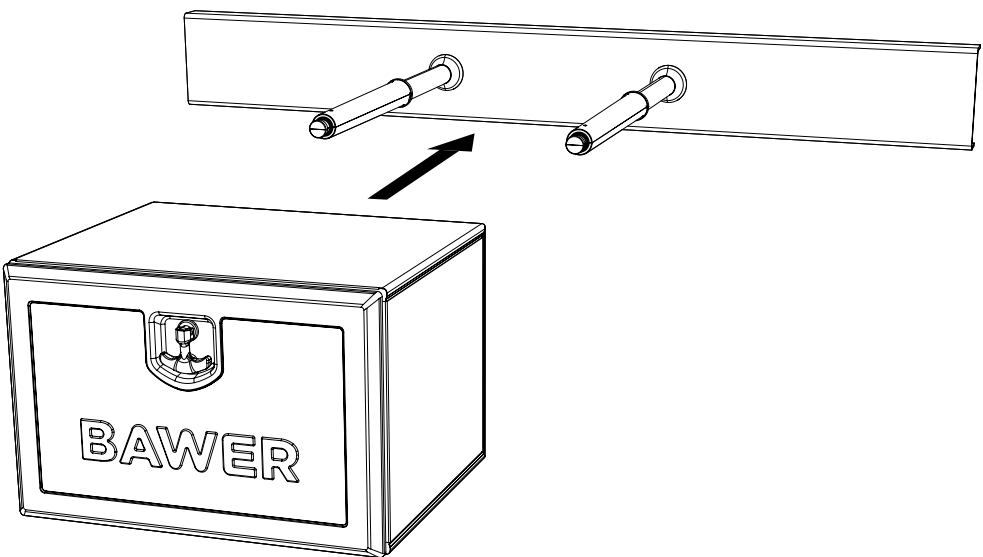

WARNING 3

Refer to the attached sheet:
Fast Mounting Product
Safety Data Sheet

ASSEMBLY **COMPLETED**

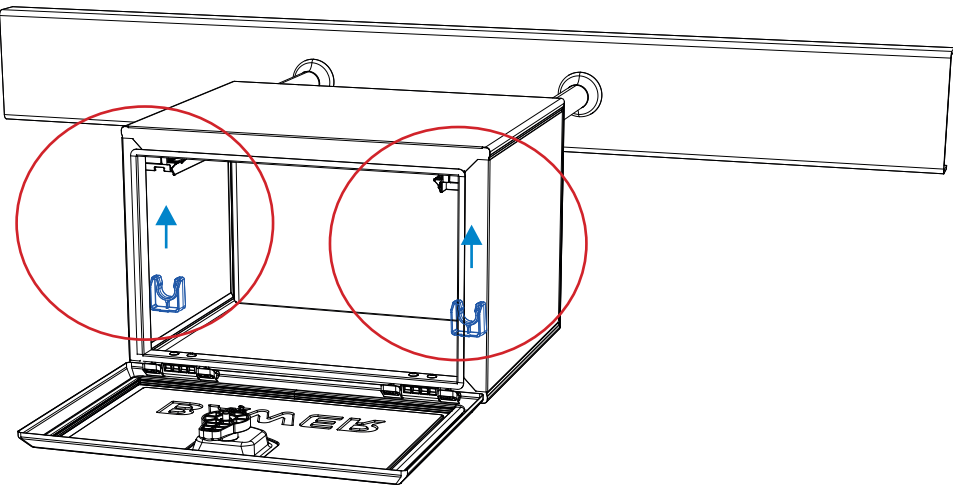

WARNING 4

Refer to the attached sheet:
Fast Mounting Product
Safety Data Sheet

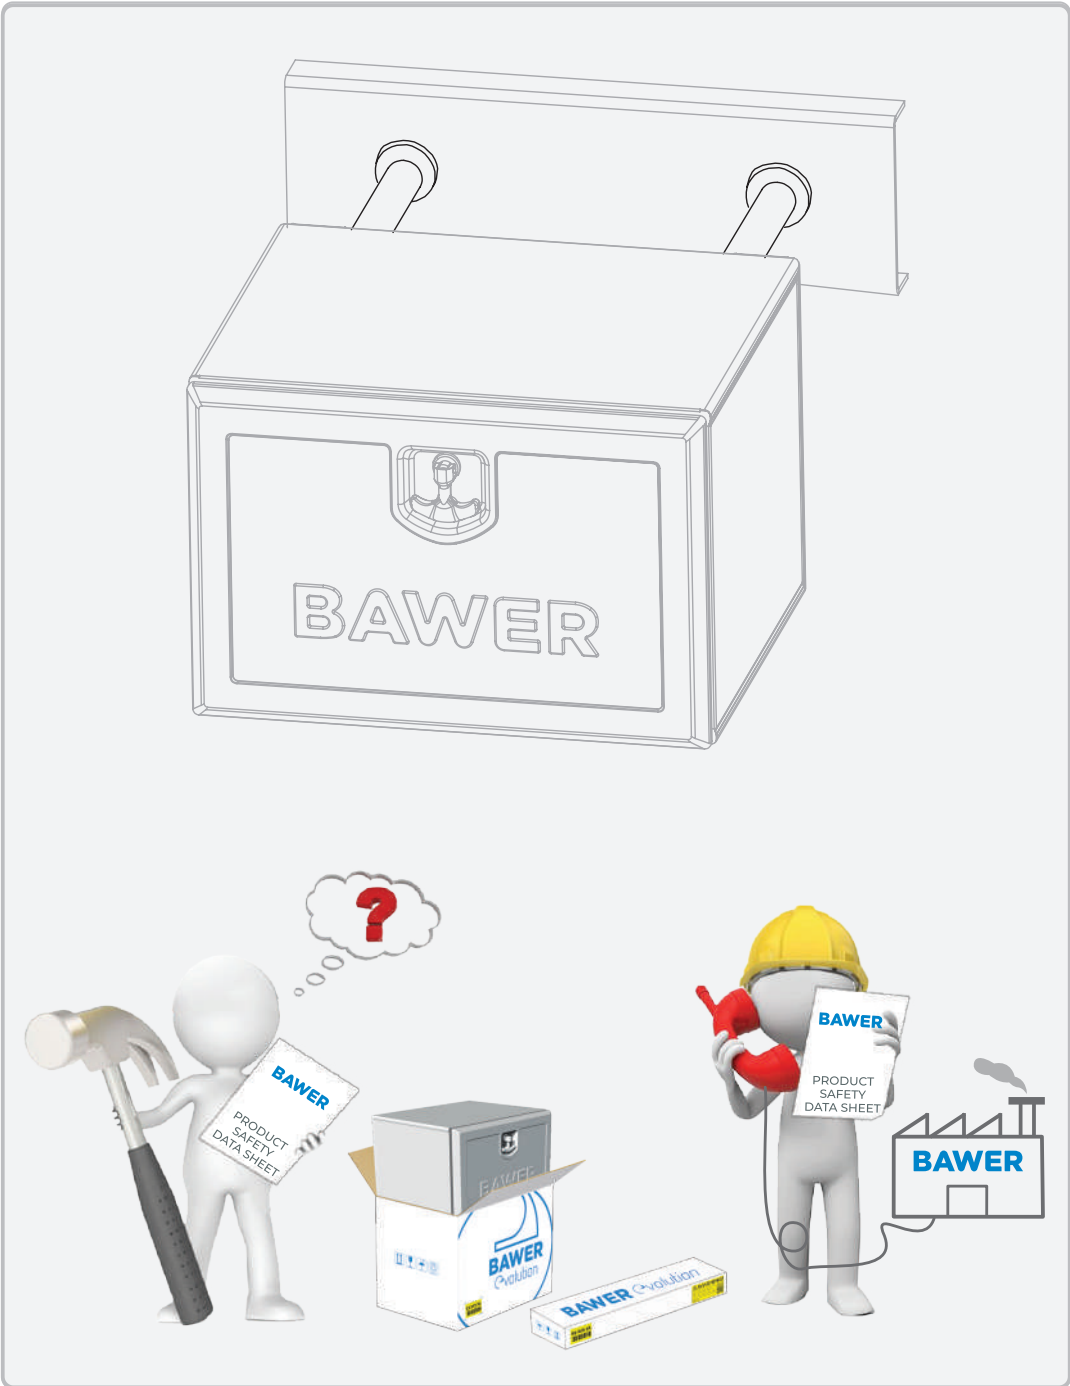


Illustration of a BAWER fast mounting box. The box is white with a BAWER logo and a picture of a person. A person is shown holding a hammer and a BAWER product safety data sheet. Another person is shown holding a BAWER product safety data sheet and a BAWER product. The BAWER logo is also visible on the box.

BAWER

PAG. 1

MC0838 Edizione 2024 Rev_2

ITALIANO
Prestare molta attenzione ai WARNING indicati.
In caso di dubbi, contattare BAWER S.p.A.
Verifica il serraggio con frequenza semestrale.

ESPAÑOL
Prestar mucha atención a las ADVERTENCIAS indicadas.
Si hay dudas, contactarse con Bawers S.p.A.
Verificar el ajuste cada seis meses.

DEUTSCH
Achten Sie bitte genau auf die angegebene WARNUNG.
Im Zweifelsfall wenden Sie sich an BAWER S.p.A.
Die Schrauben halbjährlich überprüfen und ggf. nachziehen.

ENGLISH
Pay close attention to the indicated WARNINGS.
In case of doubt, please contact BAWER S.p.A.
Check the tightening every six months.

FRANÇAIS
Veuillez prêter la plus grande attention aux WARNING indiqués.
En cas des doutes, merci de contacter Bawer S.p.A.

PACKAGING



Illustration of a BAWER fast mounting box packaging. The box is open, showing the fast mounting assembly steps. A WARNING label is visible on the box. The box is labeled "E0 XXX XX" and "BAWER".

WARNING 2



Illustration of a BAWER fast mounting box with a WARNING 2 label. The box is shown with a red line indicating the correct assembly step. A green checkmark is visible on the box.

BAWER

PAG. 2

MC0838

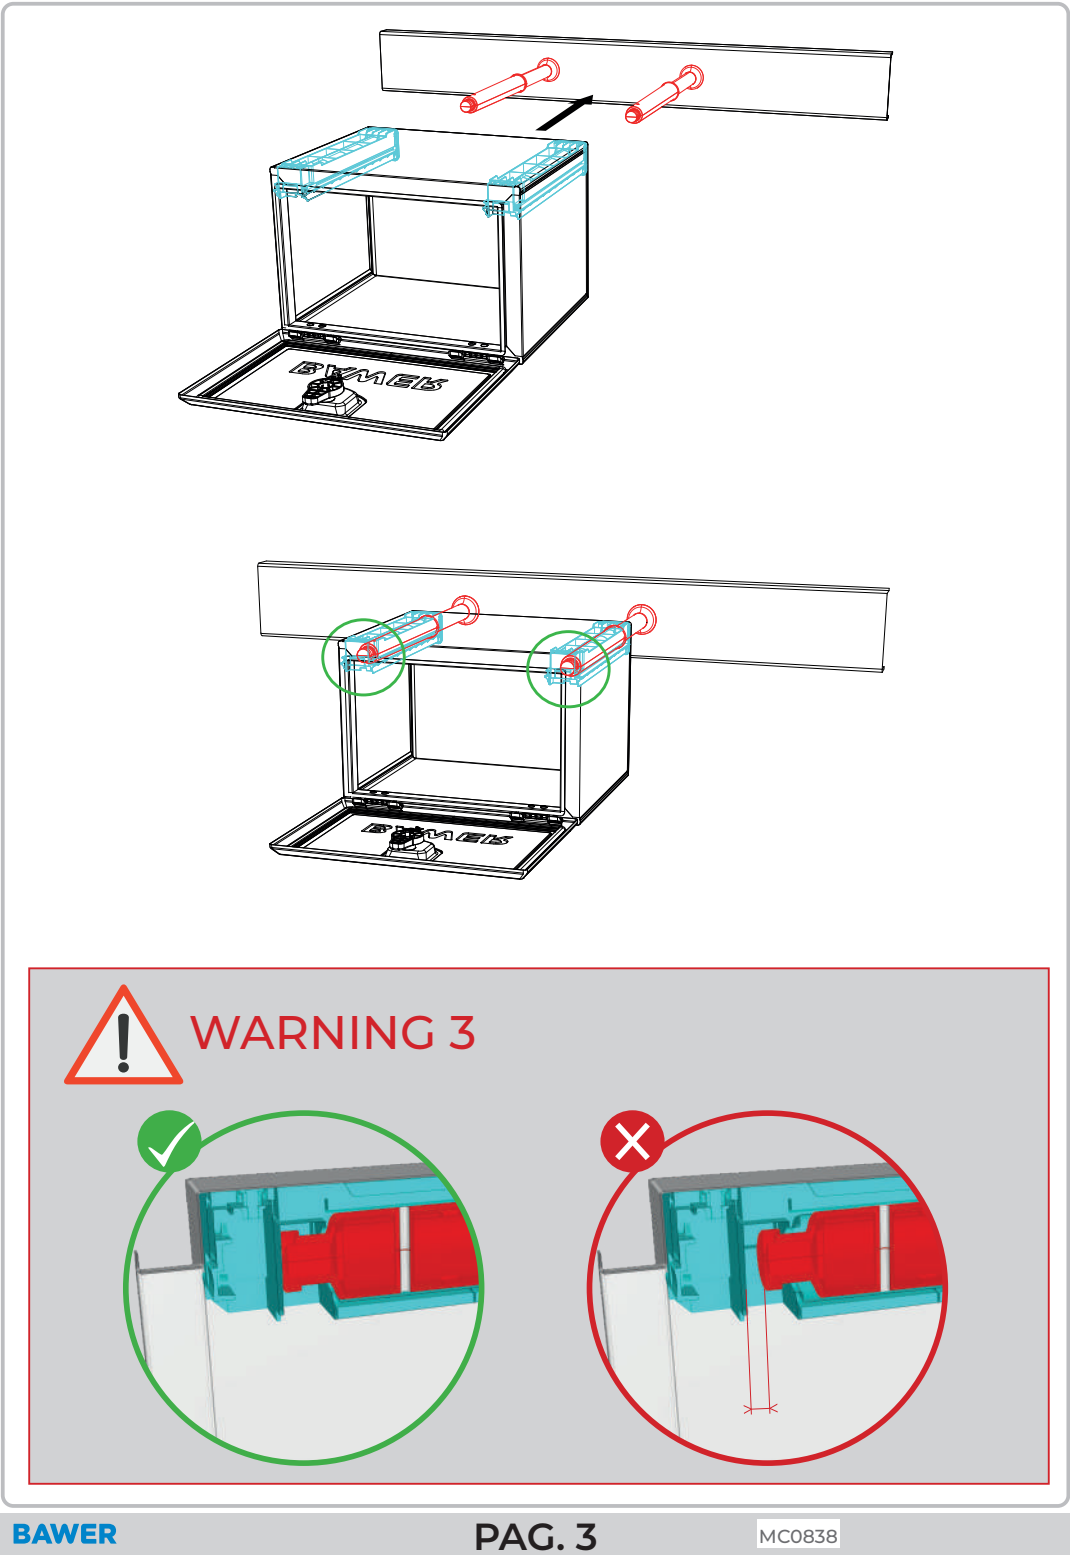


Illustration of a BAWER fast mounting box with a WARNING 3 label. The box is shown with a red line indicating the correct assembly step. A green checkmark is visible on the box.

WARNING 3

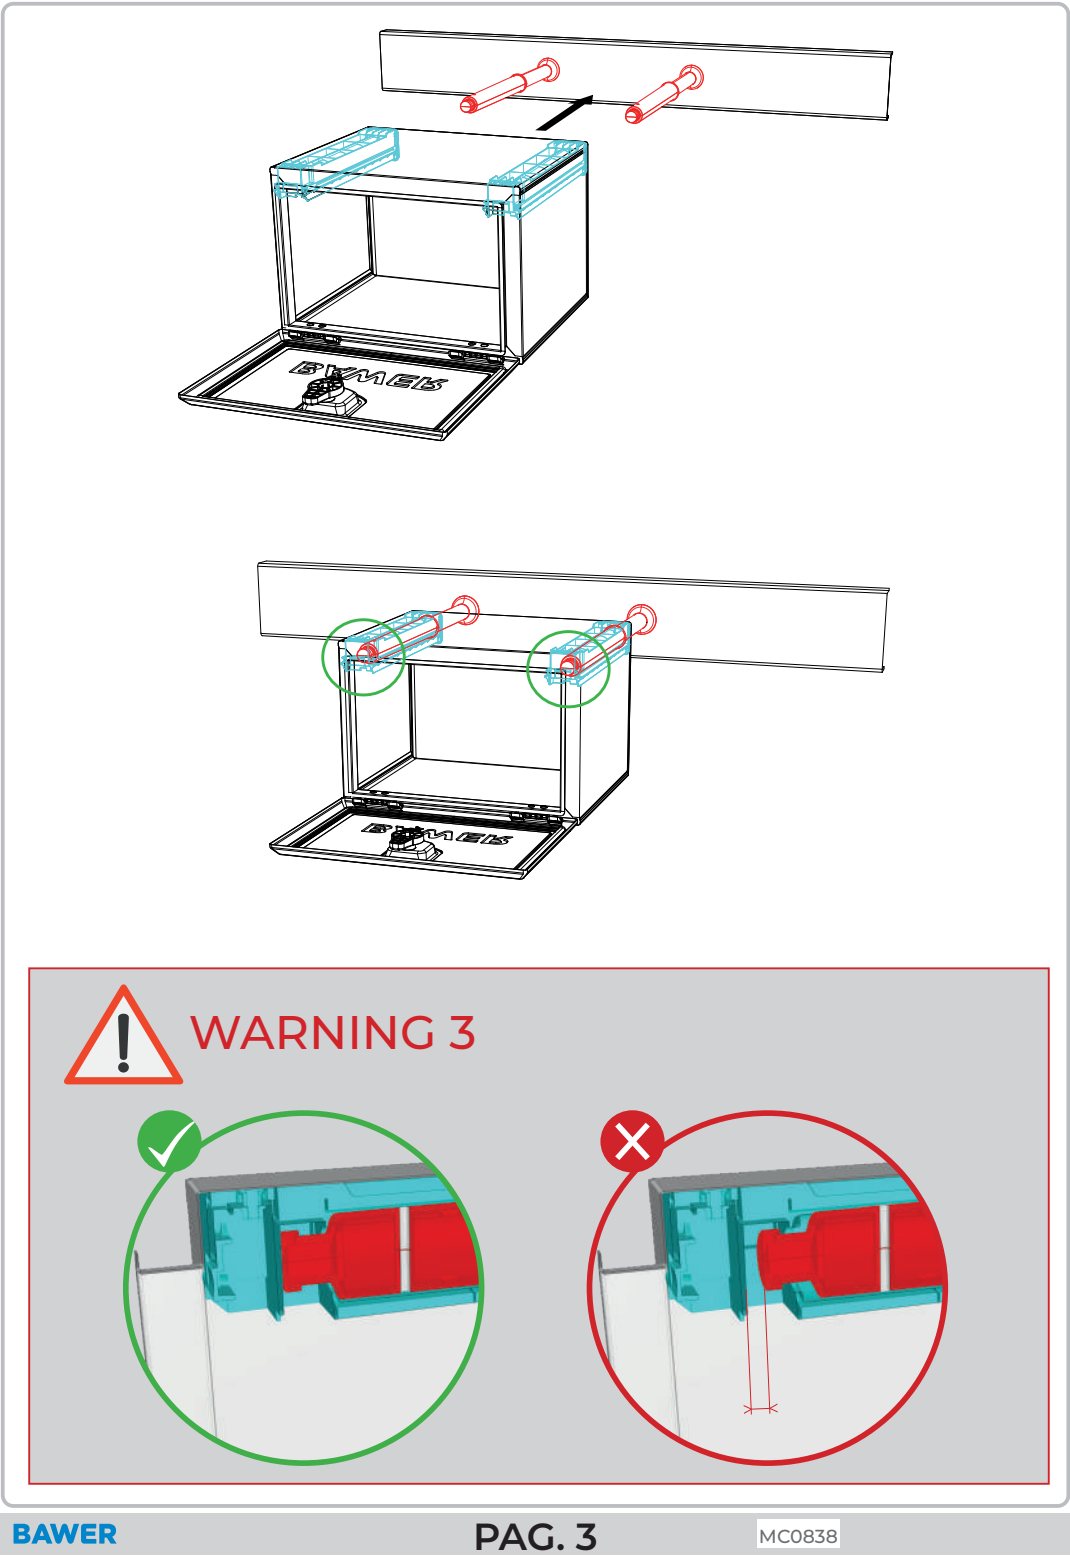


Illustration of a BAWER fast mounting box with a WARNING 3 label. The box is shown with a red line indicating the correct assembly step. A green checkmark is visible on the box.

BAWER

PAG. 3

MC0838

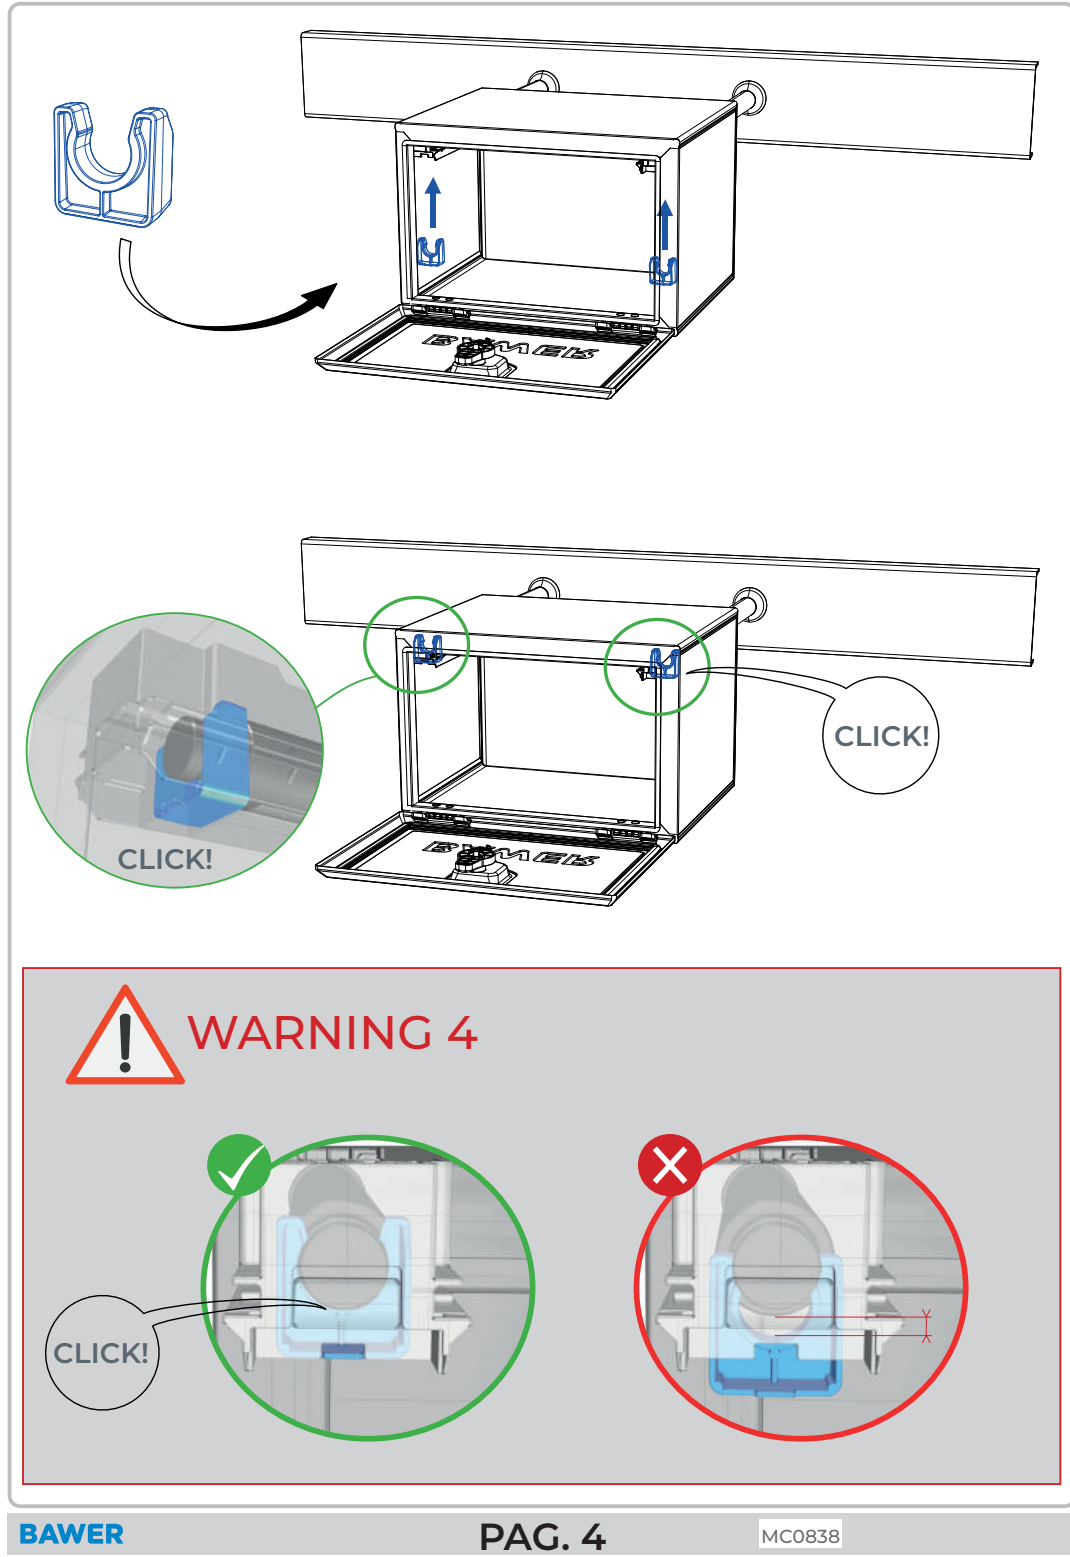


Illustration of a BAWER fast mounting box with a WARNING 4 label. The box is shown with a red line indicating the correct assembly step. A green checkmark is visible on the box.

WARNING 4

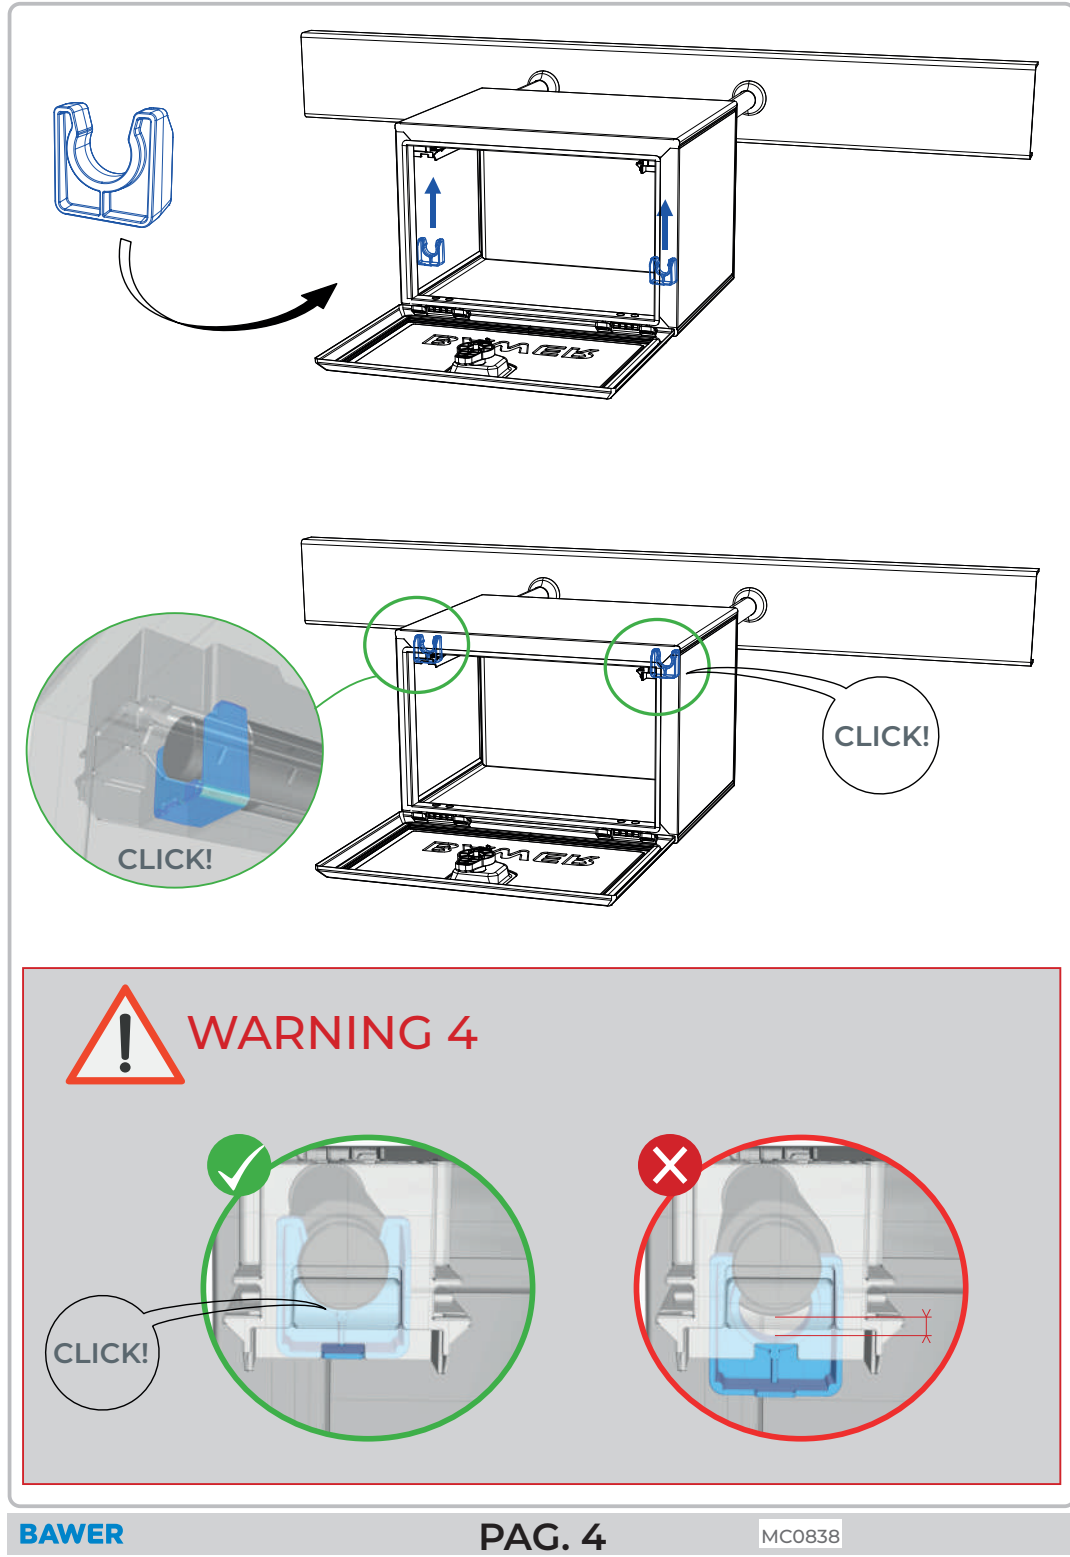


Illustration of a BAWER fast mounting box with a WARNING 4 label. The box is shown with a red line indicating the correct assembly step. A green checkmark is visible on the box.

BAWER

PAG. 4

MC0838